

RBX-114 Kit


Rubex Interchangeable Hub System Installation Instructions

It is very important to refer to your Engine's Owner Manual for important safety precautions when installing the propeller. Use the original propeller hardware thrust washer, spacer, locking tab, nut, and cotter pin depending on engine/drive manufacturer. This is a Mercury ,Force installation instruction.

- 1) Put the <u>Thrust washer (#81013130)</u> on propeller shaft just as it came off. The taper on the <u>Thrust washer (#81013130)</u> should mate properly with the taper on the propeller shaft.
- 2) Put the Rubex <u>RBX Hub (#73141301)</u> into the rear of the propeller's hub cavity (boat side). The splines on the Rubex <u>RBX Hub (#73141301)</u> should face towards the front of the propeller (tips of the blades). The Rubex <u>RBX Hub (#73141301)</u> should slide ¾ or more into propeller hub cavity or it may be backwards.
- 3) Press or tap gently the Rubex RBX Hub (#73141301) so the propeller hub is flush with the hub cavity.
- 4) Grease the propeller shaft.
- 5) Slide the propeller assembly onto the propeller shaft.
- 6) Install Aft Spacer (#81053130) if required. Consult your engine/drive manual.
- 7) Install the Tab Washer (#8108113) if required. Consult your engine/drive manual.
- 8) Install the shaft Nut. Consult your engine/drive manual for proper torque.
- 9) Secure nut by bending tabs on the Tab Washer (#8108113) to engage slots in Aft Spacer (#81053130)

WARNING:

Always shift engine into the neutral position. Remove spark plug leads and ignition coil lead when you are servicing the propeller.

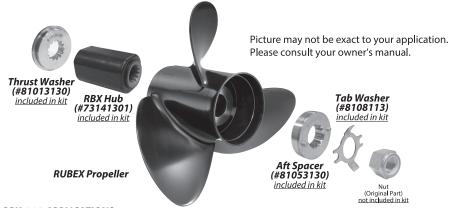

RBX-114 APPLICATIONS:

|Mercury/Mariner/Mercruiser

25 HP Bigfoot 1999-05,30 HP Bigfoot 2010 and Newer,30HP (2 & 4-Stroke)1994-05, 30 HP (Sea Pro/Marathon) 1994 & Newer, 35 HP 1984-89, 402 & 500 Models 1974-84,40 - 50 HP (2 & 4-Stroke,Not Bigfoot)1997 & Newer, 45 HP 1986-1989,48 HP (Mariner) All Years,55 HP (Sea Pro/Marathon) 1995 & Newer, 60 HP (Mariner) 1976, 60 HP (2 & 4-Stroke, Not Bigfoot or Sea Pro/Marathon) 1978 & Newer, 65 HP(Includes Model 650) 1972-1976, 70 HP(Includes Model 700) thru 1983, 80 HP (Mariner) 1977: 13 Tooth spline 3-1/4" Gearcase

Force

40/50 HP 1995-98,70 HP 1991-95, 75 HP 1996-98,13 tooth spline

Mercury, Mariner, Mercruiser, Typhoon, Quicksilver & Force are registered trademarks of the Brunswick Corporation

